



NWT OFFICE OF THE REGULATOR OF OIL AND GAS OPERATIONS

Office of the Regulator of Oil and Gas Operations

P.O. Box 1320, Yellowknife, NT X1A 2L9

Tel: 867-767-9097 • Fax: 867-920-0798 • Web: www.oro.go.gov.nt.ca

Courier Address: 4th floor, 5201 – 50th Avenue, Yellowknife, NT X1A 3S9

Ken Nikiforuk, Operations Consultant
Strategic Oil and Gas Ltd.
C/O Alvarez & Marsal Canada ULC
SUITE 1100, 250 - 6th AVE SW
CALGARY AB T2P 3H7

August 13, 2021

Dear Ken Nikiforuk:

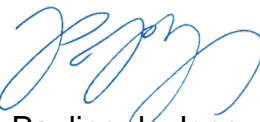
Information Request No. 2:
Application to Abandon the Cameron N-28 Well (ACW-2021-N-28-WID1753)

On August 5, 2021, the Office of the Regulator of Oil and Gas Operations (OROGO) received the response to Information Request No. 1 from Strategic Oil and Gas Ltd. (Strategic) for the abandonment of the Cameron N-28 well (WID1753) well.

OROGO has reviewed the information provided by Strategic and requires additional information in order to complete its review of Strategic's application to abandon the N-28 well, as set out in the attached Information Request No. 2

Please send your written responses and any associated correspondence to Peter Lennie-Misgeld, Senior Advisor, Legislation and Policy at oro.go@gov.nt.ca, or through OROGO's secure file transfer site, on or before 4:00 p.m. on August 30, 2021.

If you are unable to respond within this timeframe or have any questions, please contact OROGO at (867) 767-9097 or by email at oro.go@gov.nt.ca.

Sincerely,

Pauline de Jong
Regulator

Encl. Information Request No. 2

c Duncan MacRae, Director, Alvarez & Marsal Canada ULC

Bureau de l'organisme de réglementation des opérations pétrolières et gazières

B.P. 1320, Yellowknife, TNO X1A 2L9

Tél : 867-767-9097 • Téléc : 867-920-0798 • Site web : www.oro.go.gov.nt.ca

Adresse de messagerie : 4^e étage, 5201 – 50^e Avenue, Yellowknife TNO X1A 3S9



BUREAU DE L'ORGANISME DE RÉGLEMENTATION DES OPÉRATIONS PÉTROLIÈRES ET GAZIÈRES DES TNO

Strategic Oil and Gas Ltd.
Application for an Approval to Alter the Condition of a Well
Cameron N-28 Well (ACW-2021-SOG-N-28-WID1753)
Information Request No. 2

2.1 Remedial Cementing

PREAMBLE:

The updated well abandonment program submitted by Strategic on August 5, 2021 identifies that the cement bond log will be run from 1345 mKB to surface followed by abandonment of the liner top (located at approx. 732 mKB), as described in step 76. Step 87 states that if remedial cementing is required it will be conducted using procedure steps 88 to 103 following abandonment of the liner top.

There are no procedural steps identified to complete remedial cementing of the casing from 1345 mKB to 725 mKB, as the bridge plug and cement would already be in place.

REQUEST:

Please submit an updated well abandonment program, as one complete consolidated document, that contains the following information:

- Procedures that include the ability to conduct remedial cementing from 1345 mKB to surface.