



Telephone: 867-767-9187 ex.24187
Fax: 867-873-6230

February 13, 2025

Tlicho Community Government of Gameti
Box 1
Gameti, NT X0E 1R0

Attention: Richard Leong, SAO

File Number W2018L3-0001
Type of Operation CLASS B - MUNICIPAL
Location Gamètì, NT

Dear Mr. Leong,

An inspection of the above noted operation was conducted on February 12th, 2025 by Water Resource Officer Nahum Lee. Enclosed is a copy of the municipal water use inspection report.

The meter in the water treatment plant appears to have stopped working properly as the reading is identical to last inspection from September 2024. If you have any questions, please contact me at 867-767-9187 ext. 24187.

Sincerely,

Nahum Lee
Water Resource Officer
Environment and Climate Change
North Slave Region

Cc: Scott Stewart – North Slave Regional Superintendent – ECC
Wendy Bidwell – Senior Water Resource Officer – ECC
Rick Walbourne – Director – Water Regulatory – ECC
Roberta Judas – Regulatory Technician – WLWB



WATER USE INSPECTION REPORT

LICENCE #:	W2018L3-0001	EXPIRY DATE:	December 21 st , 2028
LICENCEE:	Tłjichq Community Government of Gamètì	PREVIOUS INSPECTION:	September 19, 2024
COMPANY REP:	Richard Leong	INSPECTION DATE:	February 12, 2025

WATER SUPPLY

Source:	Rae Lakes	Quantity Used:	Unknown
Owner/Operator:	Community Government of Gameti	Meter Reading:	Same as last inspection. 42137.6m ³

Indicate: **A - Acceptable** **U - Unacceptable** **N/A - Not Applicable** **N/I - Not Inspected**

Intake Facilities	A	Storage Structures	N/I	Treatment Systems	A	Recycling	N/A
Flow Meas. Device	U	Conveyance Lines	A	Pumping Stations	A	Chem. Storage	A
						Modifications	N/A

Water Supply Comments:

The water supply facilities were inspected and no major issues were noted. Sensors were all online, log books were being filled out (Photo 1), and chemicals were stored appropriately (Photo 2). Meters appeared operational but the meter reading is identical to the reading from the previous inspection. The meter must be repaired immediately (Photo 3).

WASTE DISPOSAL - SEWAGE

Disposal Method	Lagoon						
Mechanical	No	Camp Sump	No	Natural Water Body	No	Wetland Treatment	Yes
Continuous Discharge	No	Intermittent Discharge	No	Seasonal Discharge	No	Land Spread	No
Accelerated Biological	No	Other	Exfiltration Lagoon				

Indicate: **A - Acceptable** **U - Unacceptable** **N/A - Not Applicable** **N/I - Not Inspected**

Discharge Quality	A	Decant Process & Structures	N/A	Discharge Measurement Device	A
Freeboard	A	Sludge Disposal Method	A		
Periods Of Discharge	Continuous Exfiltration			SNP Samples Collected	N/A
Effluent Discharge Rates	Unknown				



WATER USE INSPECTION REPORT

Sewage Comments:

The lagoon appeared to be in working order (Photo 4). It appears that the outfall piping is damaged causing some sewage effluent to be discharged in the wrong location, although this is not an environmental concern due to the design of the lagoon, repairs should be made and efforts to discharge sewage in the proper location must be made.

WASTE DISPOSAL – SOLID WASTE

Disposal Method		Landfill					
Open Dump	No	Landfill	No	Burn & Landfill	Yes	Underground	No
Offsite Removal	No	Other					
Owner / Operator	Community Government of Gamètì						

Indicate: **A - Acceptable** **U - Unacceptable** **N/A - Not Applicable** **N/I - Not Inspected**

Runoff Diversion	N/A	SNP Samples Collected	No
------------------	-----	-----------------------	----

Solid Waste Comments:

The landfill was inspected and no major concerns were identified at this location (Photo 5). Waste segregation was excellent (Photos 6). Access to the waste segregation area was minimal which may make segregation during winter months difficult.

SURVEILLANCE NETWORK PROGRAM

Samples Collected Licencee	No
Samples Collected ENR	No

Signs Posted: SNP	Improvement Required	Warning	Yes
-------------------	----------------------	---------	-----

Surveillance Network Program Comments:

N/A

GENERAL CONDITIONS/REPORTS/PLANS

Indicate: **A - Acceptable** **U - Unacceptable** **N/A - Not Applicable** **N/I - Not Inspected**

C & R Plan	A	Records & Reporting	U	Final Report	N/A
Geotechnical Inspection	N/I	Posting, Signage	N/I	Contingency Plan	A
Restorations Activities	A	Spills	A	O&M Plan	A
Maintenance	N/I	Modifications	N/A	Annual Report	U



WATER USE INSPECTION REPORT

General Condition Comments:

There are several outstanding reports, including the 2022 Annual Report and 2023 SNP Reports. Please contact Roberta Judas with any questions you have regarding the Annual Report.

NON-COMPLIANCE/VIOLATIONS OF ACT OR LICENCE


- 1. Part B, Condition 2:** Prior to March 31 of the year following the calendar year reported, the Licensee shall file an Annual Report with the Board. The Annual Report shall contain the information set out in Schedule 1.

Explanatory Remarks: The 2024 Annual Report will be due on March 31st, 2025.

- 2. Part B, Condition 5:** The Licensee shall comply with the Surveillance Network Program, which is annexed to and forms part of this Licence, and any amendment to the Surveillance Network Program as may be made by the Board.

Explanatory Remarks: The Community Government of Gamètì remains out of compliance. Proper SNP sampling is not occurring.

Inspectors Signature:



Date:	February 12 th , 2025	Licence #:	W2018L3-0001	Page No:	3
-------	----------------------------------	------------	--------------	----------	---



WATER USE INSPECTION REPORT

Photo 1: Meter was operational.



Photo 2: Chemicals stored properly.





WATER USE INSPECTION REPORT

Photo 3: Logbook was being filled out.

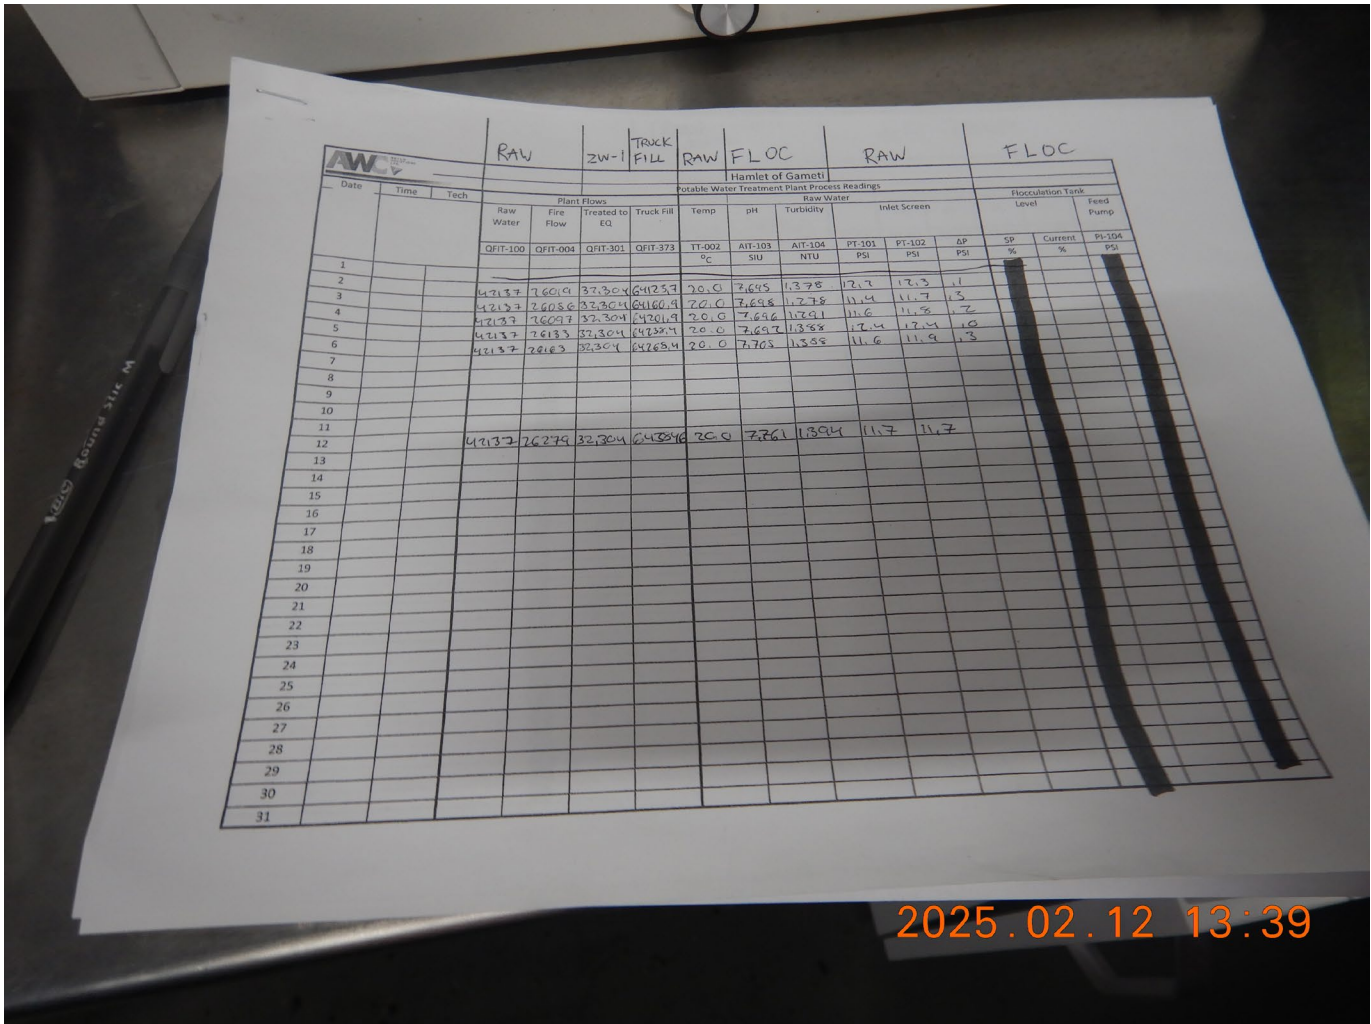


Photo 4: Lagoon. Better efforts to direct sewage to the primary cell must be made.





WATER USE INSPECTION REPORT

Photo 5: No unauthorized waste items were identified at the solid waste facility.



Photo 6: Waste segregation. Access to the waste segregation area could be improved.

